




A	128/13637	Window assembly,rear as supplied <July 2003 Supersession >	1
A	⊘ Not for sale	Window assembly,rear as supplied <M944200 Supersession > Left lock bar 75mm higher-to match side glass	1
A	128/14092	Window assembly, rear as supplied <M947217 Supersession >	1
A	128/14450	Window assembly- rear as supplied Supersession >	1
1	⊘ Not for sale	None serviced part	1
2	⊘ Not for sale	None serviced part	1
3	:335/03712	Bar torsion	1
4	:331/28221	Seal rear window left hand end	1
5	:331/28222	Seal rear window right hand end	1
6	:331/28223	Roller Plastic	2
7	:331/28224	Block roller Supersession >	2
8	:331/28226	Bracket pivot Supersession >	2
9	⊘ Not for sale	Glass rear window <M944200 > No Longer Available	1
9	:827/80287	Glass rear window <M947217 Supersession > 827/80310 found in supersession chain	1
9	:827/80310	Glass rear window < Supersession	1
10	:331/28233	Latch LH	1
10A	:331/43562	Capscrew encapsulated holds 7,8,10 & 11 to frame	12

11	:331/28235	Latch RH	1
12	:331/28239	Bar locking Supersession >	2
13	:904/20260	Seal rear window,bottom < Supersession	1
14	:331/28215	Strut gas 287 closed, 475 open	2
15	:904/20261	Seal rear window,side <M944217 < Supersession	2
15	:904/20302	Seal window side seal < Supersession	2
16	:904/20241	Seal rear window top	1
17	:331/33723	Boot left hand,rubber Supersession >	1
18	:331/33725	Boot right hand,rubber Supersession >	1
20	826/10875	Capscrew M8 x 12 < Supersession	2
20A	1370/0203D	Nut Lock M8 < Supersession fit to item 20 if required	2
21	826/10878	Screw Button Head	3
22	823/10409	Washer Black	3
23	823/00529	Washer M8	4
23	1420/0007D	Washer M8 < Supersession	2
24	826/10948	Capscrew	4
25	813/10216	Gasket foam, left hand C-post	1
26	813/10201	Gasket Foam, right hand C-Post	1
27	926/46400	Strip cab sealing 8 x 3 thk x 100 long < Supersession	2
28	4103/3201	Adhesive Sika 552, 310ml Black > No Longer Available	0
29	4104/1203	Cleaner primer SIKA 205 250ml Supersession >	0

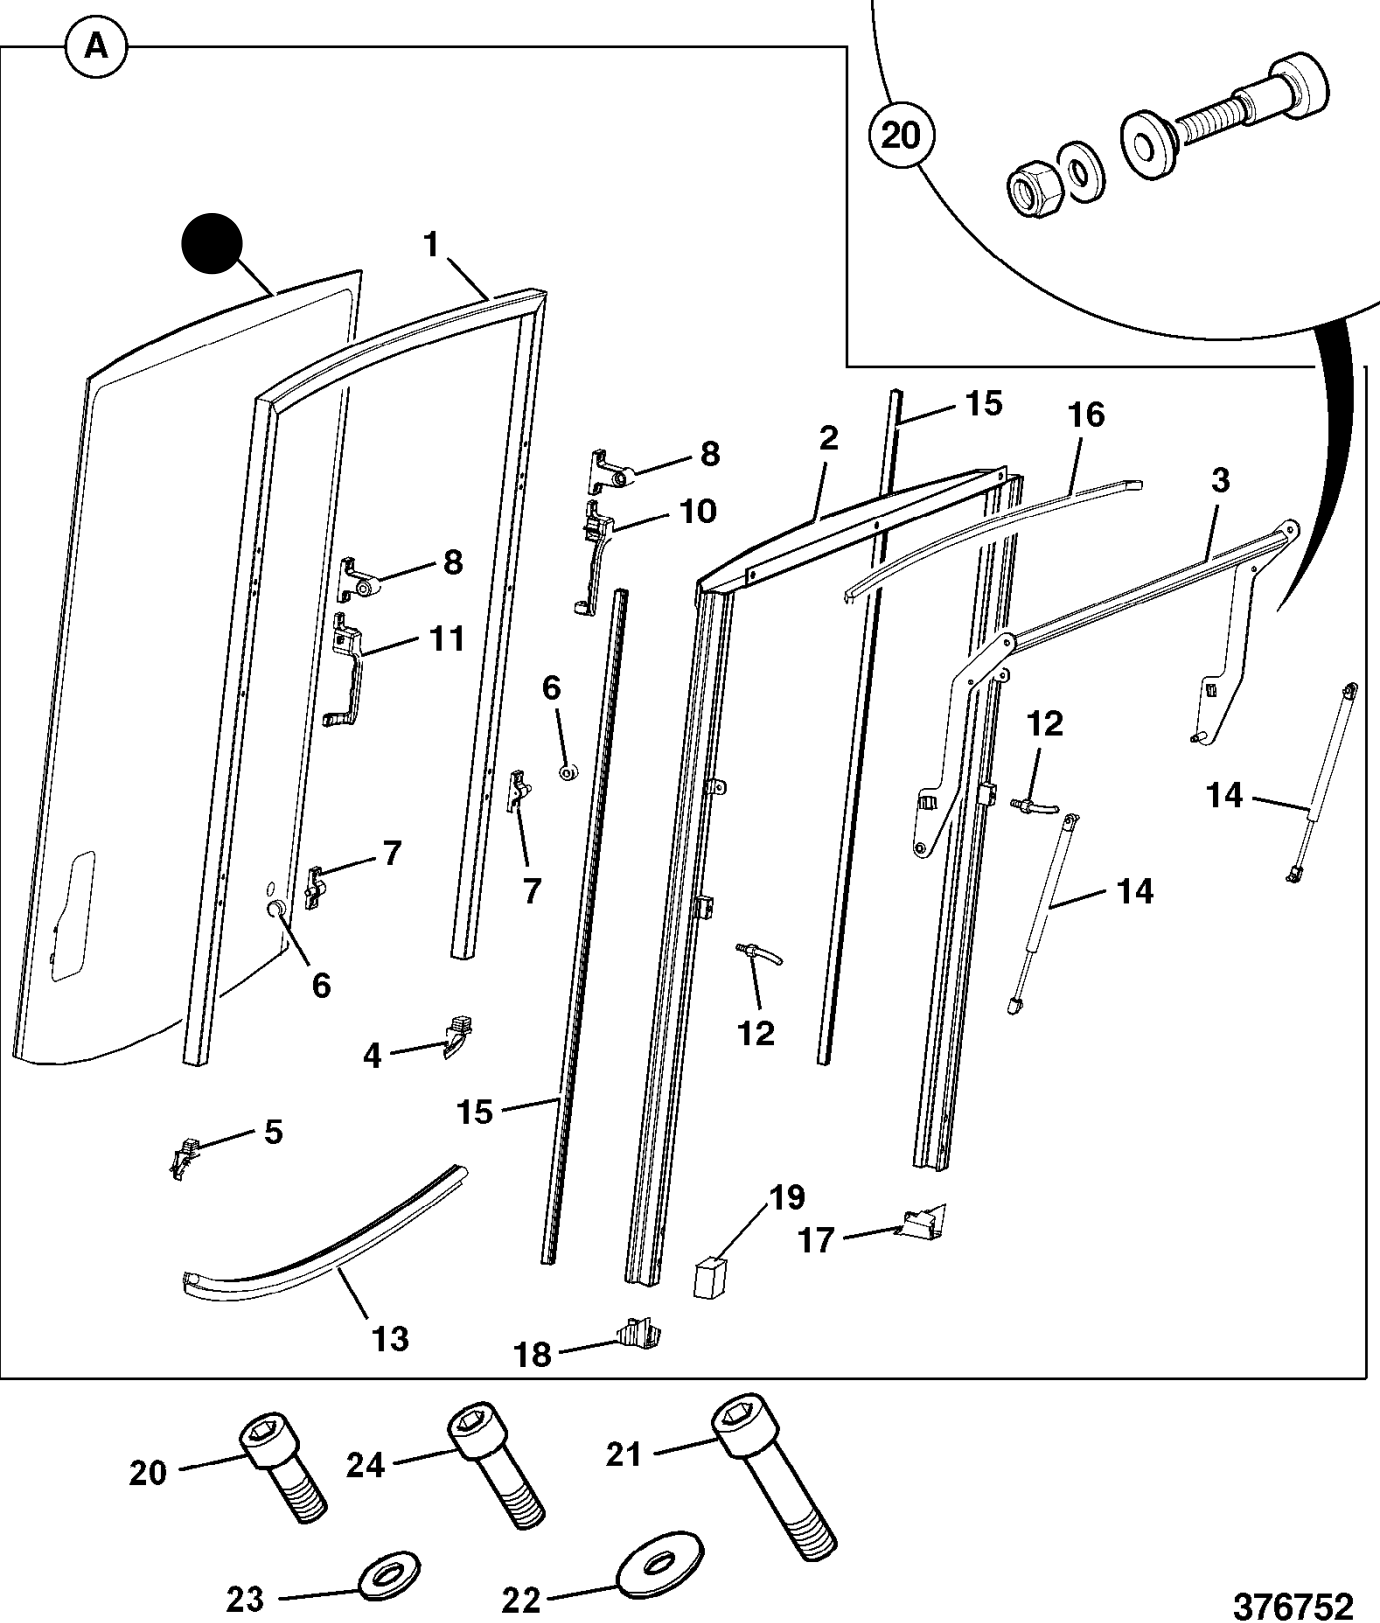